



GE Consumer & Industrial

GE Appliances
General Electric Company
Louisville, Kentucky 40225

Service Bulletin

**REFRIGERATORS
PDS22SB, PDS22LB, GBS22KB
BOTTOM-MOUNT MODELS
2001 AND LATER PRODUCTION**

REF 28-03

DECEMBER 2003

Excessive Frost in Freezer Section

Excessive frost may develop in the freezer of the PDS22SB, PDS22LB or GBS22KB bottom-mount refrigerators due to low air movement across the evaporator. These models were manufactured in 2001 or later.

If standard checks such as door alignment, gasket seal and customer usage have been attempted and excessive frost continues to develop, the installation of a higher RPM evaporator fan motor may be necessary.

This higher RPM fan motor will force a greater amount of air over the evaporator coils, drawing additional moisture from the freezer. Order kit WR49X10090, which includes the fan motor and installation instructions.