

GE Consumer & Industrial Service Bulletin

SEPTEMBER 2009

REFRIGERATOR
CENTER HINGE

REF 14-09

Problem

On some Stainless Steel units, reversal of the door swing from RH to LH will result in interference of the fresh food door end cap with the center hinge. In some cases, this will prevent the door from opening completely.

Models Affected


GTH18ISXARSS, GTH18ISXCRSS, GTH18SBXARSS,
GTH18SBXCRSS, GTS18ISXARSS, GTS18ISXBRSS,
GTS18SBXARSS, GTS18SBXBRSS, GTS18SBXCRSS,
GTS18SCXARSS, GTS18SCXBRSS, GTS18SCXCRSS,
PTS18SHSXRSS, PTS18SHSYRSS, GTH18SBTVRSS,
GTH18SBXBRSS, GTS18ISTURSS, GTS18ISTWRSS,
GTS18SBSARSS, GTS18SBSURSS, GTS18SBSVRSS,
GTS18SBSWRSS, GTS18SHSARSS, GTS18SHSVRSS,
GTS18SHXARSS, PTS18SBSVRSS, PTS18SBSWRSS,
PTS18SHSVRSS

Repair/Resolution


Replace current center hinge with new part, WR13X10144.

Note squared edges and bump in part on current part versus replacement part.

CURRENT PART: WR13X10317

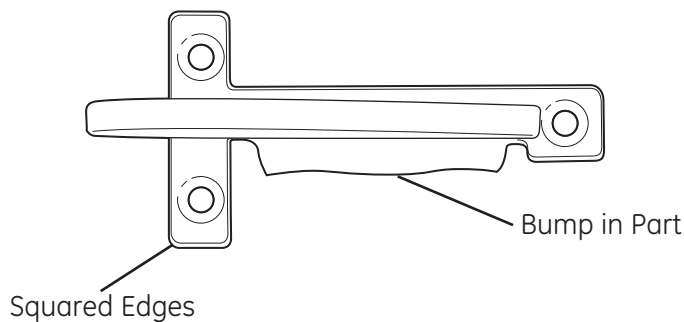

NEW PART: WR13X10144

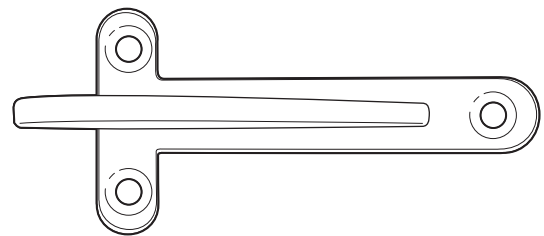

Bulletin Issuers:

Darren Moehrke, AP5 Quality Manager, 502-452-4057

Suzette Land, Quality Systems Engineer, AP5, 502-452-5843



GE Appliances
General Electric Company
Louisville, KY 40225

GE CONFIDENTIAL AND PROPRIETARY INFORMATION—NOT FOR PUBLIC DISCLOSURE

62460 11-09 JR