GE Consumer & Industrial Service Bulletin

December 2005

REFRIGERATION REF 05-05 Monogram Bottom Freezer Models Eliminate "Bubbling" Sound

Warning!To prevent electrical shock, disconnect power to the refrigerator
before you begin. Turn off the water supply.
Do not operate refrigerator until the installation is complete.

The purpose of this bulletin is to address the complaint of a "Bubbling" sound on Monogram Bottom Freezer Refrigerators. This sound is similar to that of an aquarium air pump and is caused by the refrigerant passing through the oil in the accumulator. This condition is corrected by replacing the accumulator assembly with a new accumulator kit WR49X10143

Models Affected: ZIC360NRRH, ZIC360NRLH, ZICS360NRRH, & ZICS360NRLH

Part Required: Accumulator Kit WR49X10143 (Includes Accumulator, (4) wire ties, & (4) wire clips)

Tools required: #2 Phillips Screwdriver Wire Cutter Brazing Torch

Procedure: Remove the Accumulator and replace with Accumulator Assembly WR49X10143. See installation instructions included with the new accumulator assembly for detailed step-by-step instructions.



GE Appliances General Electric Company Louisville, Kentucky 40225

GE CONFIDENTIAL AND PROPRIETARY INFORMATION-NOT FOR PUBLIC DISCLOSURE