

Service Bulletin

GE Monogram

General Electric Company Appliance Park, Louisville, KY 40225 GE MONOGRAM REFRIGERATORS REF 09-00 BOTTOM-MOUNT & SXS MODELS 1993 to CURRENT INTERMITTENT LIGHT & EVAPORATOR FAN SWITCH OPERATION

JUNE 2000

INTERMITTENT LIGHT AND EVAPORATOR FAN SWITCH OPERATION

Complaints listed below are likely to be the result of intermittent contact of the refrigerator doors with the light and evaporator switches in bottom-mount and side-by-side models.

Problems:

- 1. Too cold or too warm
- 2. Intermittent operation
- 3. Light staying on
- 4. Fan not running
- 5. No or low ice production

The field correction part, actuator

WR02X10470 will correct the problem. You will need an actuator for fresh food and freezer doors.

To Install Actuator:

- 1. To determine appropriate screw location, place actuator against hinge overlapping back edge of door.
- 2. Remove actuator and existing screw.
- 3. Remove release paper from back of actuator. Align actuator with proper screw hole and reinstall screw as shown in Figure 1. Press down on opposite end to ensure adhesion to door

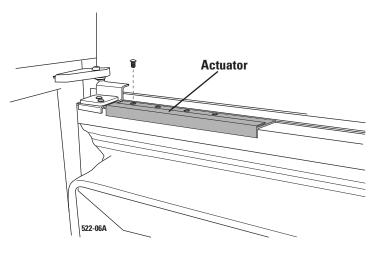


Fig. 1