


**GE Monogram** 

General Electric Company Appliance Park, Louisville, KY 40225

On some early GE Monogram bottom mount stainless steel models (ZICS36N) RH & LH the fresh food door panel may be wavy. Use panel spacer kit WR49X10023 to eliminate this problem.

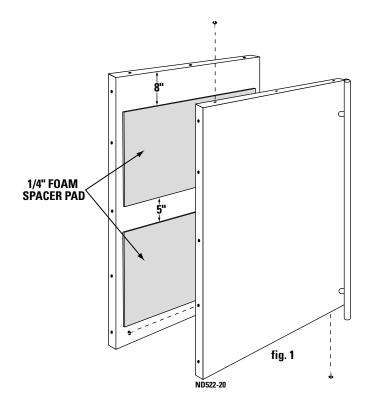

## Service Bulletin

GE MONOGRAM REFRIGERATORS REF 14-00 ZICS36N MODELS BUILT SINCE 1998 WAVY FRESH FOOD STAINLESS STEEL DOOR PANEL (OIL CANNING) PANEL SPACER KIT WR49X10023

**AUGUST 2000** 

## To remove stainless steel door panel:

- Open fresh food door and remove mounting screws located on the top, hinge side and bottom flanges of the stainless steel panel.
- 2. Grasp panel by the handle and hinge side.
- 3. Pull out and up on the stainless steel panel to remove from the fresh food door.
- 4. Carefully place the stainless steel panel to the side to prevent damage.

## To install foam spacer pads:

- 1. Remove paper backing from the foam pads.
- 2. Using the dimensions from figure 1, position foam pads on the front of the fresh food door.
- 3. Press firmly against the foam pads for proper adhesion.

## To reinstall stainless steel door panel:

- Place top edge of the stainless steel panel over the top of the fresh food door and rotate down onto the door.
- 2. Insert mounting screws into the top flange (do not tighten).
- 3. Push bottom edge of stainless steel panel against the fresh food door. There will be some resistance because of the 1/4" foam pad.
- 4. Insert remaining screws across the bottom then the hinge side of the stainless steel panel (do not tighten).
- 5. Make sure the stainless steel panel is shifted to the hinge side as far as possible. This will minimize the gap between the side of the door and the stainless steel panel on the handle side.
- 6. Tighten all screws.

1 of 1 N.D. 522-22