

GE Appliances General Electric Company Louisville, Kentucky 40225

Service Bulletin


REFRIGERATION ICEMAKER TOO MUCH ICE

REF 13-04

MAY 2004

Service calls for continuous ice production, too much ice in the bucket, ice cubes over-flowing the bucket, ice cubes falling behind the bucket or ice lifting the chiller shelf can now be resolved by installing a redesigned feeler arm.

The new arm is designed with a slight curve to cycle the icemaker "OFF" before the cubes overflow the ice bucket. Order part number WR49X10103.

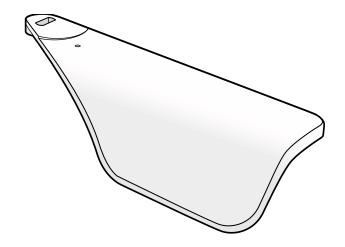

Icemaker Feeler Arm WR49X10103