

Service Bulletin

MARCH 2009

REFRIGERATOR
MODELS PFSS6, PFSF6 PRODUCED
JULY 2007 THROUGH FEBRUARY 2008
SERIAL NUMBERS: MM070000 to DR079999

REF 02-09

ICE NOT AVAILABLE/NOISY ICEMAKER/NO ICE PRODUCTION

When the icemaker dumps ice cubes to the ice bucket, ice cubes jam between the icemaker and the liner. The icemaker makes a loud noise and eventually stops working.



REPAIR

Replace both the icemaker **WR30X10097** and the mainboard **WR55X10763** if they meet the following criteria:

Replace the icemaker if the blue tag on the bottom indicates it was produced prior to 2008.3.01 (March 1, 2008).

Replace the mainboard if the software version is lower than 4.02 on the left processor.

NOTE: Recent production of these models use a different mainboard. When board replacement is required, always consult the parts catalog for the correct replacement part.

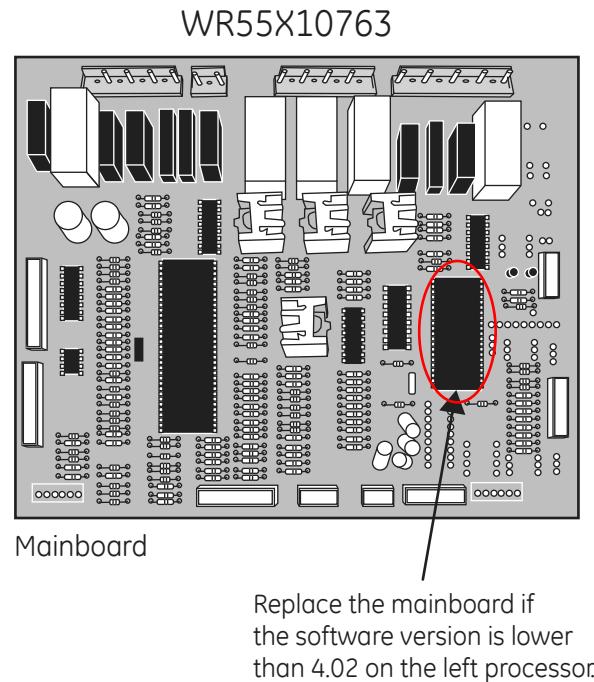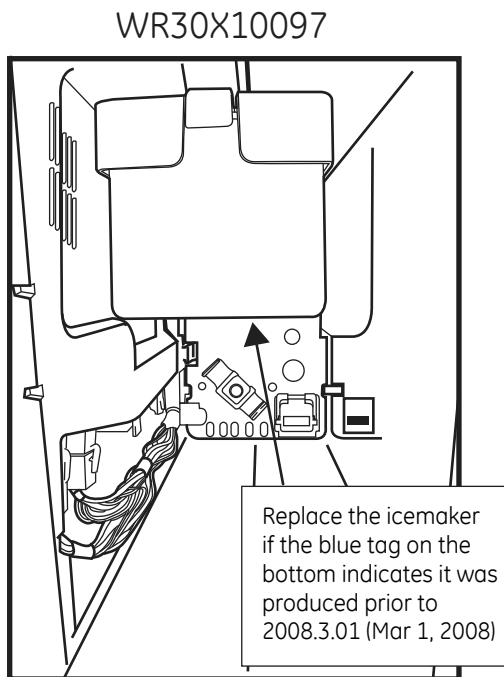

GE Appliances
General Electric Company
Louisville, Kentucky 40225

GE CONFIDENTIAL AND PROPRIETARY INFORMATION—NOT FOR PUBLIC DISCLOSURE